


OneAdvisor-800

Recovery Procedure

This procedure describes the steps required to reimage OneAdvisor's firmware.

Format a microSD card to be used for the upgrade by Format Removable Disk (E:) opening file manager and doing a right-click on the Capacity: microSD drive and select 7.39 GB v "Format". File system • Make sure the File System is FAT32 (Default) FAT and the Allocation unit Allocation unit size size is 32 kilobytes 32 kilobytes • Select "Start" Restore device defaults Volume label Format options ✓ Quick Format Create an MS-DOS startup disk Start Close http://ona-800.updatemyunit.net Download the reimage firmware from the site Double click on the downloaded executable file Name installer-1.400.0024r.cc2b524.fae1e15-reimage In case windows is running a protection software or firewall, the following warning message might be displayed



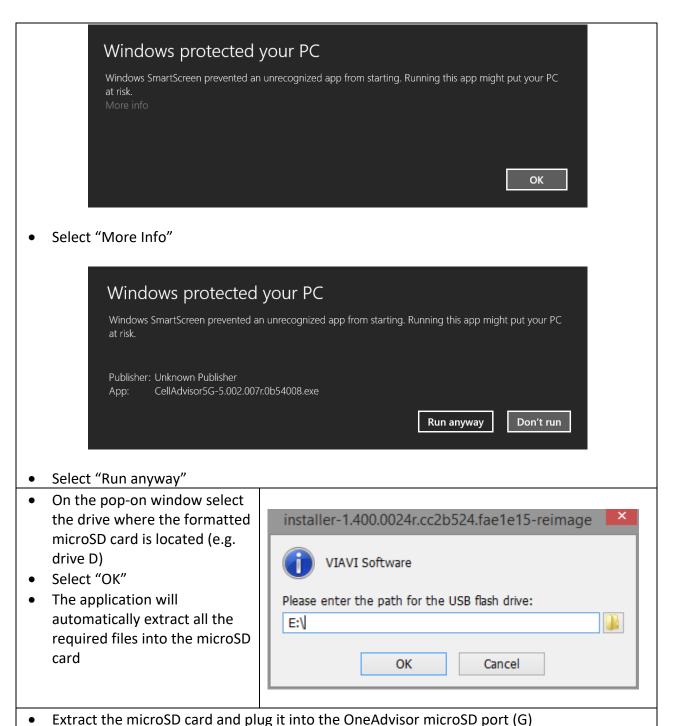

, ,



© LAN Port USB Port Ext Power Port @ microSD Slot B Power Button USB Port USB OTG Port Expansion Slot D (E) H 1 RF Port 3 Trigger Out GNSS Antenna 7 SFP28 Slot 2 Ext Reference 4 Trigger In 6 SFP+ Slots QSFP Slot

OneAdvisor Top View

• Reboot the OneAdvisor

OneAdvisor will initialize by installing the firmware from the microSD card in terminal mode.

At the completion of the firmware installation and verification it'll indicate to remove the microSD card to continue.

The OneAdvisor will restart and initialize.